

YOUR ONESURVEY  
**HOME REPORT**

---

**ADDRESS**

---

The Lodge House  
301 Albert Drive  
Glasgow  
G41 5RP

**PREPARED FOR**

---

Tony Orr

**INSPECTION CARRIED OUT BY:**



**SELLING AGENT:**



**HOME REPORT GENERATED BY:**



# Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	Glasgow South - Allied Surveyors Scotland Plc	24/05/2022
<u>Mortgage Certificate</u>	Final	Glasgow South - Allied Surveyors Scotland Plc	24/05/2022
<u>Property Questionnaire</u>	Final	Mr. Tony Orr	23/05/2022
<u>EPC</u>	File Uploaded	Glasgow South - Allied Surveyors Scotland Plc	24/05/2022
Additional Documents	File Uploaded		

## Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit [www.onesurvey.org](http://www.onesurvey.org) (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

# SINGLE SURVEY

---

A report on the condition of the property, with categories being rated from 1 to 3.



# Single Survey

Survey report on:

<b>Surveyor Reference</b>	WG/6906
---------------------------	---------

<b>Customer</b>	Mr. Tony Orr
-----------------	--------------

<b>Selling address</b>	The Lodge House 301 Albert Drive Glasgow G41 5RP
------------------------	---

<b>Date of Inspection</b>	20/05/2022
---------------------------	------------

<b>Prepared by</b>	David Donnachie, BSc MRICS Glasgow South - Allied Surveyors Scotland Plc
--------------------	---

# SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

#### **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## **1.9 PRECEDENCE**

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## **1.10 DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

---

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## **PART 2 – DESCRIPTION OF THE REPORT**

### **2.1 THE SERVICE**

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### **2.2 THE INSPECTION**

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### **2.3 THE REPORT**

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

*"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an*

*arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

*“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

<b>Description</b>	The subjects comprise a detached former lodge house one storey and attic in height. It is understood that the building is listed.
<b>Accommodation</b>	Ground floor: Entrance hall, sitting room, living room, kitchen and bathroom (WC).  Upper floor: Two bedrooms
<b>Gross internal floor area (m2)</b>	84 square metres or thereby
<b>Neighbourhood and location</b>	The property is located within the Pollokshields district of to the south of Glasgow, where surrounding, properties are of mixed design, vintage and character.  Adequate local shopping, educational and transport facilities are available.
<b>Age</b>	Over 100 years old
<b>Weather</b>	It was dry and sunny at the time of the inspection.
<b>Chimney stacks</b>	The chimney stacks are of stone construction with metal flashings.  Visually inspected with the aid of binoculars where required.
<b>Roofing including roof space</b>	The roof is pitched and slated, with the ridges being capped with metal plating. There is a section of felt roof covering to the side of the building.

	<p>Ceiling hatches to the bedrooms provide access into the roof spaces, there is insulation material at joist level within the front roof slope.</p> <p>Our inspection of the roof spaces were restricted to the areas around the access hatches only.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p>
<p><b>Rainwater fittings</b></p>	<p>The gutters and downpipes are formed in a mixture of UPVC and cast iron sections. It was not raining at the time of our inspection and the adequacy of the system could not be verified.</p> <p>Visually inspected with the aid of binoculars where required.</p>
<p><b>Main walls</b></p>	<p>These main walls are of solid stone construction.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>
<p><b>Windows, external doors and joinery</b></p>	<p>The windows are a mixture of timber sash and casement and timber casement single glazed units. There is a sky light feature to the bathroom ceiling.</p> <p>The front entrance door is of timber, with the rear door being of UPVC and double glazed.</p> <p>Not all of the windows and doors were tested.</p> <p>The external fascias are of painted timber.</p> <p>Internal and external doors were opened and closed where keys were available.</p>


	<p>Random windows were opened and closed where possible. Doors and windows were not forced open.</p>
<b>External decorations</b>	<p>UPVC and painted finishes.</p> <p>Visually inspected.</p>
<b>Conservatories / porches</b>	<p>There are no conservatories nor porches.</p>
<b>Communal areas</b>	<p>There are no communal areas.</p>
<b>Garages and permanent outbuildings</b>	<p>There is a single car garage attached to the side.rear of the property which is of stone construction under a pitched slated roof. The garage is open sided into the walled garden area.</p> <p>There are no outbuildings.</p> <p>Visually inspected.</p>
<b>Outside areas and boundaries</b>	<p>There is garden to the front, and rear of the property which is of concrete slabs with a flower border to the front.</p> <p>The boundaries are formed in stone wall.</p> <p>Visually inspected.</p>
<b>Ceilings</b>	<p>The ceilings are of lath and plaster/plasterboard or similar.</p> <p>Visually inspected from floor level.</p>
<b>Internal walls</b>	<p>The internal walls and partitions are a mixture of plaster on hard, lath on plaster and plasterboard or similar.</p> <p>The walls within the kitchen and bathroom are partly tiled.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
<b>Floors including sub floors</b>	<p>Flooring is a mixture of timber and concrete construction.</p> <p>Due to fitted carpets and floor coverings no detailed inspection of the floors was possible and accordingly no comment can be made on their condition.</p> <p>No access was available to any sub-floor area.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p>

	<p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
<p><b>Internal joinery and kitchen fittings</b></p>	<p>The internal doors are of timber, with glass panelling the kitchen door.</p> <p>The door surrounds and skirting boards are of timber.</p> <p>The kitchen fittings comprise a range of floor and wall-mounted units and are of a relatively modern design.</p> <p>The staircase to first floor is of timber and carpeted, with timber handrail fitted to the wall.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
<p><b>Chimney breasts and fireplaces</b></p>	<p>The former fireplaces have been removed and boarded over.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
<p><b>Internal decorations</b></p>	<p>Painted and papered finishes.</p> <p>Visually inspected.</p>
<p><b>Cellars</b></p>	<p>There are no cellars.</p>
<p><b>Electricity</b></p>	<p>It is assumed that the property has a mains supply of electricity. The electricity meter and distribution board are located within a hall cupboard.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p><b>Gas</b></p>	<p>It is assumed that the property has a main supply of gas. The gas meter is contained within a hall cupboard.</p> <p>Accessible parts of the system were visually inspected</p>

	<p>without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p><b>Water, plumbing and bathroom fittings</b></p>	<p>It is assumed that the property has a main supply of cold water.</p> <p>Plumbing where seen is a mixture of PVC and copper. In older properties such as this there is a possibility of led plumbing being hidden from view.</p> <p>The bathroom fittings comprise a three piece suite with bath and mixer shower over, WC and wash hand basin.</p> <p>There is a stainless steel sink and drainer fitted within the kitchen.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</p>
<p><b>Heating and hot water</b></p>	<p>The property has the benefit of a gas fired central heating system. The central heating boiler is wall-mounted within a hall cupboard. There are thermostatic valves to the majority of the individual radiators and the room thermostat to the hall wall.</p> <p>Hot water is supplied by the central heating boiler.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.</p>
<p><b>Drainage</b></p>	<p>All foul and surface water drainage is assumed to be connected to the main public sewer. The system was not tested.</p> <p>Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.</p>
<p><b>Fire, smoke and burglar</b></p>	<p>There is a smoke alarm installed within the property.</p>

<p><b>alarms</b></p>	
<p><b>Any additional limits to inspection</b></p>	<p>Externally the property was viewed from ground level only.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.</p> <p>The property had fitted floor coverings, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.</p> <p>Windows and external doors were not all fully opened or tested.</p> <p>No access was available to any sub-floor areas.</p> <p>Full and safe access was not available to the roof void areas due to the limited available access. Our inspection of the roof spaces was restricted to the area around the access hatches only. Insulation material to the front room space restricted our inspection further.</p> <p>We were not able to fully inspect all areas of boundary walls due to garden vegetation and restricted access.</p> <p>No inspection has been possible to flooring timbers beneath sanitary fittings or kitchen appliances and timbers are assumed to be in a satisfactory condition.</p> <p>The garage vehicular door was not fully opened or tested.</p> <p>The cold water rising main was not fully inspectable.</p> <p>Flat roof coverings were not inspectable.</p>

# Sectional Diagram showing elements of a typical house

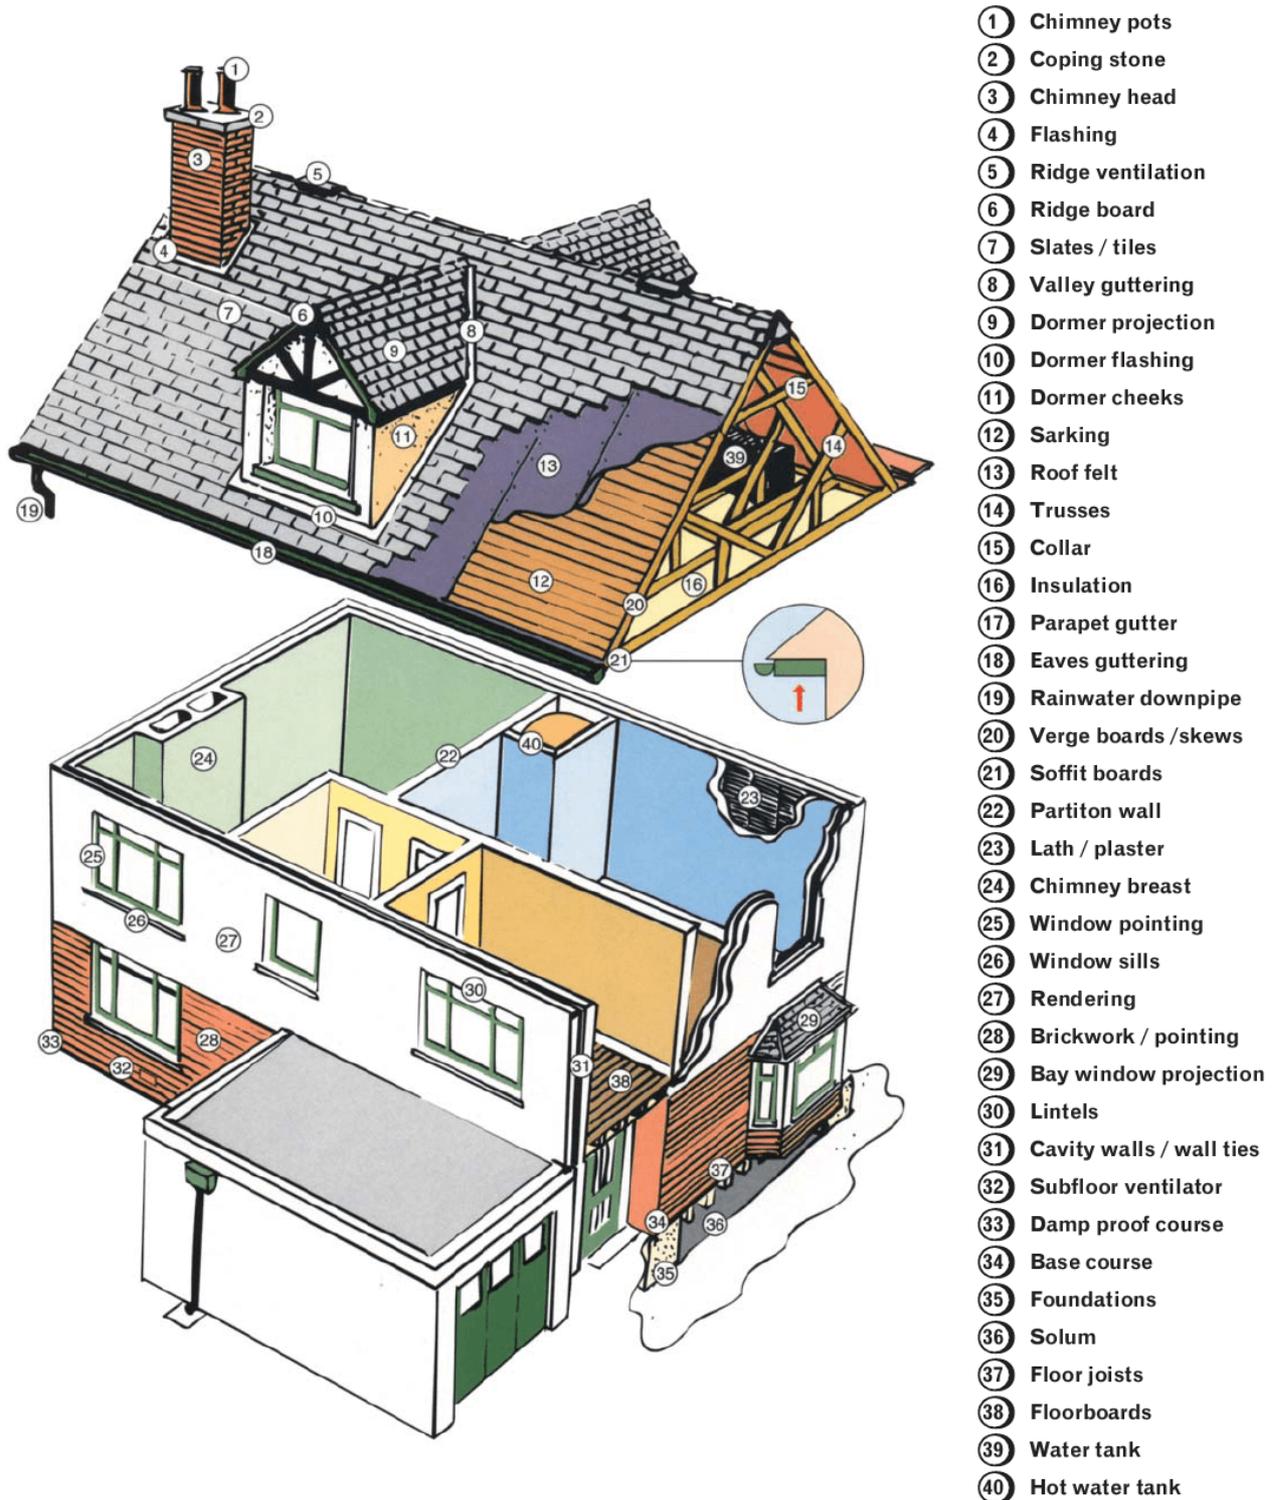

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	
Notes:	Evidence of settlement/movement has affected the building . On the basis of a single inspection this appears longstanding with no evidence of recent movement apparent.

Dampness, rot and infestation	
Repair category:	
Notes:	Above average damp readings were obtained to localised sections of lower wall lining at ground floor level. A precautionary check of the entire property should be carried out by a reputable timber specialist prior to purchase.  It is understood that the property has been inspected by Rowallan (see attached report). These repairs should be carried out and covered by guarantee.

Chimney stacks	
Repair category:	
Notes:	Weathered and defective chimney masonry is visible, and repairs are required.

Roofing including roof space
------------------------------

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	<p>A number of loose or broken roof slates and components were visible. Roof coverings are of an age and style where a degree of regular ongoing maintenance should be anticipated. More extensive overhaul work may be required in future.</p> <p>There are flat felt sections of roof covering. It should be appreciated that this type of covering can have a limited life span and will require a higher than normal degree of ongoing maintenance and eventual replacement. It may be prudent to confirm the service history of the roof covering.</p> <p>Our inspection of the roof spaces was restricted to the area around the access hatches only. Limited insulation within the roof spaces.</p>

Rainwater fittings	
Repair category:	
Notes:	<p>Within the limitations of our inspection rainwater goods were seen to be free from significant defect.</p> <p>We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.</p>

Main walls	
Repair category:	
Notes:	<p>Weathered stonework and mortar joints were noted to external walls and repairs are required. Repairs to traditional stone materials can be expensive, particularly to ornate finishes.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, external doors and joinery	
Repair category:	2
Notes:	<p>Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.</p> <p>Evidence of weathering was noted to external joinery which will deteriorate if left unattended.</p>

External decorations	
Repair category:	1
Notes:	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories / porches	
Repair category:	
Notes:	Not applicable.

Communal areas	
Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings
------------------------------------

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	<p>Normal maintenance will be required to the garage.</p> <p>Evidence of decay to external fascias to the garage.</p> <p>Garage not opened, nor tested.</p> <p>High ground level to side of garage.</p> <p>There are trees close to the garage which may cause future problems.</p>

Outside areas and boundaries	
Repair category:	
Notes:	<p>Boundary walls are showing signs of weathering and repairs are required.</p> <p>There are retaining walls within the garden. These appear to be in sound condition at present but should be regularly checked and maintained in good condition to prevent landslip.</p> <p>There are mature trees close to the property which will require future ongoing professional maintenance by an experienced contractor.</p>

Ceilings	
Repair category:	
Notes:	<p>Within the limitations of our inspection no significant defects were noted.</p> <p>Some cracked/uneven ceiling plaster was noted and some repairs</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	may be required at the time of redecoration or disturbance.
--	---

Internal walls	
Repair category:	
Notes:	Damaged wall plaster was noted and repairs are required.

Floors including sub-floors	
Repair category:	
Notes:	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category:	
Notes:	<p>Within the limitations of our inspection no significant defects were noted.</p> <p>Low level glazing to kitchen doors should be checked for safety glass.</p> <p>Internal joinery is generally serviceable however some wear and tear items were noted and future maintenance or upgrading should be anticipated.</p>

Chimney breasts and fireplaces
--------------------------------

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	Fireplaces have been removed or blocked without the installation of adequate ventilation. Ventilators should be fitted to prevent the build up of dampness within the chimney flue.

Internal decorations	
Repair category:	
Notes:	The property is in fair decorative order although redecoration in line with personal taste maybe considered.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	
Notes:	The Institute of Electrical Engineers recommends that inspections and testings are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IEE regulations.

Gas
-----

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

<b>Water, plumbing and bathroom fittings</b>	
Repair category:	
Notes:	<p>No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.</p> <p>The cold water rising main was not fully inspectable.</p> <p>Sanitary fittings appear serviceable however surround seals/tiling/finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.</p>

<b>Heating and hot water</b>	
Repair category:	
Notes:	<p>It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.</p> <p>The central heating boiler system is on semi-dated lines. Further advice should be obtained from a gas safe registered contractor to fully ascertain the condition, life expectancy and efficiency of the system.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage	
Repair category:	1
Notes:	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

<b>Structural movement</b>	1
<b>Dampness, rot and infestation</b>	2
<b>Chimney stacks</b>	2
<b>Roofing including roof space</b>	2
<b>Rainwater fittings</b>	1
<b>Main walls</b>	2
<b>Windows, external doors and joinery</b>	2
<b>External decorations</b>	1
Conservatories / porches	
Communal areas	
<b>Garages and permanent outbuildings</b>	2
<b>Outside areas and boundaries</b>	2
<b>Ceilings</b>	1
<b>Internal walls</b>	2
<b>Floors including sub-floors</b>	1
<b>Internal joinery and kitchen fittings</b>	1
<b>Chimney breasts and fireplaces</b>	1
<b>Internal decorations</b>	1
Cellars	
<b>Electricity</b>	2
<b>Gas</b>	1
<b>Water, plumbing and bathroom fittings</b>	1
<b>Heating and hot water</b>	2
<b>Drainage</b>	1

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

### 3. ACCESSIBILITY INFORMATION

#### Guidance Notes on Accessibility Information

**Three steps or fewer to a main entrance door of the property:** In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

**Unrestricted parking within 25 metres:** For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and First Floors.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

#### 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

<b>Matters for a solicitor or licensed conveyancer</b>	
<p>Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.</p> <p>It is understood that the property is a listed building and located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Scotland.</p> <p>It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.</p> <p>The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
<b>Estimated re-instatement cost (£) for insurance purposes</b>	
<p>£500,000 For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £500,000 (Five Hundred Thousand Pounds).</p>	
<b>Valuation (£) and market comments</b>	
<p>£290,000 Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £290,000 (Two Hundred and Ninety Thousand Pounds).</p> <p>The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.</p>	
<b>Report author:</b>	David Donnachie, BSc MRICS

<b>Company name:</b>	Glasgow South - Allied Surveyors Scotland Plc
<b>Address:</b>	246 Kilmarnock Road Glasgow G43 1TT
<b>Signed:</b>	Electronically Signed: 206645-26c568ba-a39c
<b>Date of report:</b>	24/05/2022

P A R T 2 .

# MORTGAGE VALUATION REPORT

---

Includes a market valuation of the property.





## Mortgage Valuation Report

Property:	The Lodge House 301 Albert Drive Glasgow G41 5RP	Client: Mr. Tony Orr  Tenure: Ownership
Date of Inspection:	20/05/2022	Reference: WG/6906

*This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.*

### 1.0 LOCATION

The property is located within the Pollokshields district of to the south of Glasgow, where surrounding, properties are of mixed design, vintage and character.

Adequate local shopping, educational and transport facilities are available.

### 2.0 DESCRIPTION

#### 2.1 Age:

Over 100 years old

The subjects comprise a detached former lodge house one storey and attic in height. It is understood that the building is listed.

### 3.0 CONSTRUCTION

Walls are solid stone construction. Rood pitched and slated with flat felt sections.

### 4.0 ACCOMMODATION

Ground floor: Entrance hall, sitting room, living room, kitchen and bathroom (WC).

Upper floor: Two bedrooms

### 5.0 SERVICES (No tests have been applied to any of the services)

<b>Water:</b>	Mains	<b>Electricity:</b>	Mains	<b>Gas:</b>	Mains	<b>Drainage:</b>	Mains
---------------	-------	---------------------	-------	-------------	-------	------------------	-------

**Central Heating:** Gas fired boiler serving radiators.

### 6.0 OUTBUILDINGS

<b>Garage:</b>	Single car open sided stone and slate.				
<b>Others:</b>	None.				
<b>7.0</b>	<b>GENERAL CONDITION</b> - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
At the time of inspection the property was found to be in need of some modernisation and upgrading.					
No inspection was possible of floors due to the presence of fitted floor coverings.					
<b>8.0</b>	<b>ESSENTIAL REPAIR WORK</b> (as a condition of any mortgage or, to preserve the condition of the property)				
As recommended by a timber/damp specialist contractor.					
<b>8.1 Retention recommended:</b>	Per estimates.				
<b>9.0</b>	<b>ROADS &amp; FOOTPATHS</b>				
Roads made and assumed adopted.					
<b>10.0</b>	<b>BUILDINGS INSURANCE (£):</b>	500,000	<b>GROSS EXTERNAL FLOOR AREA</b>	105	<b>Square metres</b>
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					
<b>11.0</b>	<b>GENERAL REMARKS</b>				
<p>Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.</p> <p>It is understood that the property is a listed building and located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Scotland.</p> <p>It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.</p> <p>The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>					
<b>12.0</b>	<b>VALUATION</b> <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>				
<b>12.1</b>	<b>Market Value in present</b>	<b>£290,000</b>	Two Hundred and Ninety Thousand pounds.		

	<b>condition (£):</b>		
<b>12.2</b>	<b>Market Value on completion of essential works (£):</b>	<b>£290,000</b>	Two Hundred and Ninety Thousand Pounds
<b>12.3</b>	<b>Suitable security for normal mortgage purposes?</b>	Yes	
<b>12.4</b>	<b>Date of Valuation:</b>	20/05/2022	
<b>Signature:</b>		Electronically Signed: 206645-26c568ba-a39c	
<b>Surveyor:</b>	David Donnachie	BSc MRICS	<b>Date:</b> 24/05/2022
<b>Glasgow South - Allied Surveyors Scotland Plc</b>			
<b>Office:</b>	246 Kilmarnock Road Glasgow G43 1TT	Tel: 0141 636 5345 Fax: email: <a href="mailto:glasgow.south@alliedsurveyorsscotland.com">glasgow.south@alliedsurveyorsscotland.com</a>	

P A R T 3 .

# ENERGY REPORT

---

A report on the energy efficiency of the property.



# energy report

energy report on:

<b>Property address</b>	The Lodge House 301 Albert Drive Glasgow G41 5RP
-------------------------	---

<b>Customer</b>	Mr. Tony Orr
-----------------	--------------

<b>Customer address</b>	The Lodge House 301 Albert Drive Glasgow G41 5RP
-------------------------	---

<b>Prepared by</b>	David Donnachie, BSc MRICS Glasgow South - Allied Surveyors Scotland Plc
--------------------	---

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

THE LODGEHOUSE , 301 ALBERT DRIVE, GLASGOW, G41 5RP


<b>Dwelling type:</b>	Detached house	<b>Reference number:</b>	0130-2350-8050-2322-3651
<b>Date of assessment:</b>	20 May 2022	<b>Type of assessment:</b>	RdSAP, existing dwelling
<b>Date of certificate:</b>	22 May 2022	<b>Approved Organisation:</b>	Elmhurst
<b>Total floor area:</b>	84 m <sup>2</sup>	<b>Main heating and fuel:</b>	Boiler and radiators, mains gas
<b>Primary Energy Indicator:</b>	404 kWh/m <sup>2</sup> /year		

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£3,558</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£1,947</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

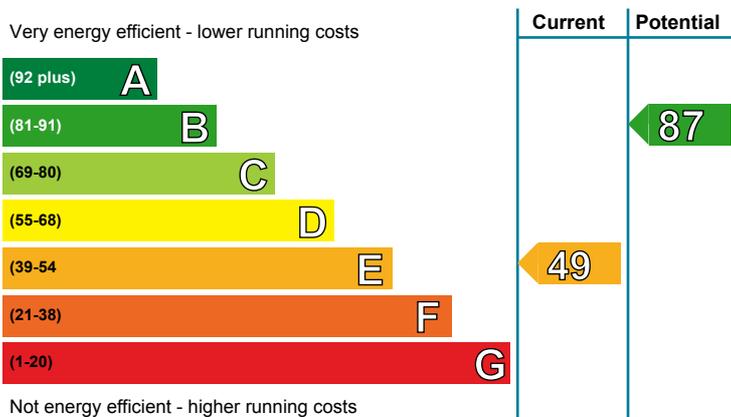


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (49)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

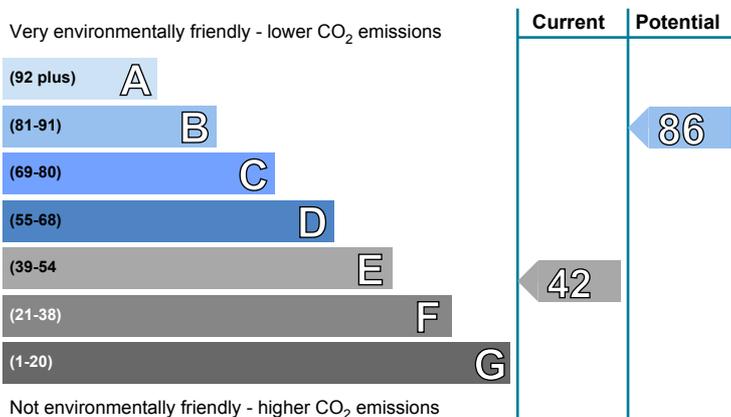

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (42)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£162.00
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£336.00
3 Internal or external wall insulation	£4,000 - £14,000	£690.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 100 mm loft insulation Pitched, no insulation Flat, no insulation (assumed)	★★★☆☆ ★☆☆☆☆ ★☆☆☆☆	★★★☆☆ ★☆☆☆☆ ★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Single glazed	★☆☆☆☆	★☆☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 24% of fixed outlets	★★☆☆☆	★★☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 71 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,889 over 3 years	£1,206 over 3 years	
Hot water	£300 over 3 years	£195 over 3 years	
Lighting	£369 over 3 years	£210 over 3 years	
<b>Totals</b>	<b>£3,558</b>	<b>£1,611</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£54		
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£112		
3 Internal or external wall insulation	£4,000 - £14,000	£230		
4 Floor insulation (suspended floor)	£800 - £1,200	£61		
5 Low energy lighting for all fixed outlets	£65	£48		
6 Replace boiler with new condensing boiler	£2,200 - £3,000	£47		
7 Solar water heating	£4,000 - £6,000	£26		
8 Replace single glazed windows with low-E double glazed windows	£3,300 - £6,500	£72		
9 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£317		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 4 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 5 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 6 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

## 7 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## 8 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

## 9 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	18,691	(1,203)	N/A	(4,952)
Water heating (kWh per year)	2,143			

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. David Donnachie
Assessor membership number:	EES/014057
Company name/trading name:	Allied Surveyors Scotland Plc
Address:	14 Clydesdale Street Hamilton ML3 0DP
Phone number:	01698 421361
Email address:	<a href="mailto:hamilton@alliedsurveyors.com">hamilton@alliedsurveyors.com</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

# PROPERTY QUESTIONNAIRE

---

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



# Property Questionnaire

Property Address

The Lodge House  
301 Albert Drive  
Glasgow  
G41 5RP

Seller(s)

Anthony Orr

Completion date of property questionnaire

23/05/2022

Note for sellers

<b>1.</b>	<b>Length of ownership</b>
	<b>How long have you owned the property?</b> 13 years
<b>2.</b>	<b>Council tax</b>
	<b>Which Council Tax band is your property in? (Please circle)</b> [ ]A [ ]B [ ]C [ ]D [ ]E [ ]F [ ]G [ ]H
<b>3.</b>	<b>Parking</b>
	<b>What are the arrangements for parking at your property? (Please tick all that apply)</b>
	Garage <span style="float: right;">[x]</span>
	Allocated parking space <span style="float: right;">[ ]</span>
	Driveway <span style="float: right;">[x]</span>
	Shared parking <span style="float: right;">[ ]</span>
	On street <span style="float: right;">[ ]</span>
	Resident permit <span style="float: right;">[ ]</span>
	Metered parking <span style="float: right;">[ ]</span>
	Other (please specify):

# property questionnaire

<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
<b>6.</b>	<b>Alterations/additions/extensions</b>	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	

# property questionnaire

<b>7.</b>	<b>Central heating</b>	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Gas fired</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>15 years ago</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract <i>British GAs Homecare</i>	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). <i>October 2021</i>	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
<b>9.</b>	<b>Issues that may have affected your property</b>	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
	<b>Services</b>	

# property questionnaire

<b>10.</b>																										
a	Please tick which services are connected to your property and give details of the supplier:																									
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td style="text-align: center;">Y</td> <td>SSE</td> </tr> <tr> <td>Water mains or private water supply</td> <td style="text-align: center;">Y</td> <td>Scottish Water</td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;">Y</td> <td>SSE</td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;">Y</td> <td>Scottish Water</td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;">N</td> <td></td> </tr> <tr> <td>Cable TV or satellite</td> <td style="text-align: center;">N</td> <td></td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;">N</td> <td></td> </tr> </tbody> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	Y	SSE	Water mains or private water supply	Y	Scottish Water	Electricity	Y	SSE	Mains drainage	Y	Scottish Water	Telephone	N		Cable TV or satellite	N		Broadband	N		
Services	Connected	Supplier																								
Gas or liquid petroleum gas	Y	SSE																								
Water mains or private water supply	Y	Scottish Water																								
Electricity	Y	SSE																								
Mains drainage	Y	Scottish Water																								
Telephone	N																									
Cable TV or satellite	N																									
Broadband	N																									
b	Is there a septic tank system at your property?	[ ] YES [x] NO																								
	If you have answered yes, please answer the two questions below:																									
	(i) Do you have appropriate consents for the discharge from your septic tank?	[ ] YES [ ] NO [ ] Don't know																								
	(ii) Do you have a maintenance contract for your septic tank?	[ ] YES [ ] NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract:																									
<b>11.</b>	<b>Responsibilities for shared or common areas</b>																									
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	[ ] YES [x] NO [ ] Don't know																								
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	[ ] YES [x] NO [ ] N/A																								
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[x] YES [ ] NO																								
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries?	[x] YES [ ] NO																								

# property questionnaire

	If you have answered yes, please give details: <i>Common Bin Area at rear of property</i>	
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[ ]YES [x]NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[ ]YES [x]NO
<b>12.</b>	<b>Charges associated with your property</b>	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[ ]YES [x]NO
b	Is there a common buildings insurance policy?	[ ]YES [x]NO [ ]Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
<b>13.</b>	<b>Specialist works</b>	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[x]YES [ ]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property. <i>Rising damp treated around 2009</i>	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[ ]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[ ]YES [x]NO
	If you have answered yes, these guarantees will be needed by	

# property questionnaire

	the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	
--	---	--

<b>14.</b>	<b>Guarantees</b>	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

<b>15.</b>	<b>Boundaries</b>	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
	<b>Notices that affect your property</b>	

# property questionnaire

<b>16.</b>		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	[ ]YES [x]NO
b	that affects your property in some other way?	[ ]YES [x]NO
c	that requires you to do any maintenance, repairs or improvements to your property?	[ ]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

<b>Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.</b>	
Signature(s):	Anthony Orr
Capacity:	[ ]Owner [x]Legally Appointed Agent for Owner
Date:	23/05/2022



**Independent Surveyors for Fungal Decay, Woodworm  
Dampness and Basement Waterproofing**

30 John Finnie Street  
Kilmarnock  
KA1 1DD

Tel 01563 529716  
info@rowallansurveys.co.uk  
www.rowallansurveys.co.uk

## **SURVEY REPORT**

**Customer:** Patricia Doogan

**Property:** The Lodge  
301 Albert Drive  
Glasgow  
G41 5RP

**Surveyor:** Michael Caldwell

**Survey Date:** 16/05/2022

**Ref No:** 10183

**Report Date:** 16/05/2022

Property Description: Detached Cottage

May we take this opportunity to thank you for choosing Rowallan Specialist Surveys to carry out this inspection. We confirm you have asked us to inspect the accessible timbers for fungal decay, infestation by wood boring insect and accessible areas for dampness.

Our objective in preparing this report for you is to ensure that you have full transparency of the problems identified, are aware of the costs involved and to provide you with the solutions to rectify these problems with the minimum of disruption.

So that you can be confident in our diagnosis, our surveyors are fully qualified to CSRT/ CSSW level.

Our inspection was restricted to the areas designated below and was of a non-disruptive nature. Should there be any other areas of concern to you that we have not commented on or if you would like a more detailed examination involving exposure works, we would be pleased to undertake this for you on receipt of further instruction (written permission will require to be obtained from the property owner). Parts of the property which cannot be accessed will not be reported upon and this will be stated in the report, however, should the surveyor suspect that a defect may exist, he may recommend that a further inspection is required.

All directions given in our report were taken from the outside of the property facing the front elevation wall.

## **Roofs**

### **OBSERVATIONS**

Access was possible adjacent to hatches to front and rear roofs. Inspection was severely restricted due to method of construction (ie, coombed ceilings), insulation materials, dust and debris. No access to inspect flat roof timbers was possible.

Some of the timbers are water stained. Moisture penetration via roof coverings, flashings, etc can result in the moisture content of timbers being excessive, in that, it would permit the germination of spores of wood destroying fungi. We therefore recommend that you arrange for the roof coverings to be inspected and repaired as required under separate contract. If during the course of this work you require further inspection, please do not hesitate to contact us.

Where inspection was possible, no apparent surface visual evidence of fungal decay or infestation was noted.

## **First Floor Level**

### **OBSERVATIONS**

Inspection was generally restricted by floor coverings.

Where inspection was possible, no apparent surface visual evidence of fungal decay or infestation was noted.

## **Ground Floor Level**

### **OBSERVATIONS**

Inspection was generally restricted by floor coverings. Floors appear to be a mixture of solid concrete and timber overlay. No sub-floor inspection was possible.

Where inspection was possible, no apparent surface visual evidence of fungal decay or infestation was noted.

At the time of our survey, visual and instrumental inspection did not indicate the presence of rising damp. We, therefore, make no recommendations for specialist damp-proofing treatments at this time.

Damp readings and some damage noted to walls either side of the junction between roofs. We understand that moisture ingress was addressed some time ago, however, dampness persists to contaminated plaster.

### **RECOMMENDATIONS**

A sketch has been enclosed to assist in the identification of treatment areas.

#### **Works by Specialist Contractor:**

Carefully remove and set aside skirtings, facings, etc and reinstate/ renew on completion.

Carefully hack off and remove existing wall plaster to areas and heights as indicated.

Install a ventilated, lathed membrane to exposed surfaces of masonry to isolate substrate from plaster finish.

Gypsum bonding plaster or plasterboard is to be applied to membrane followed by finishing plaster.

## **GENERAL NOTES**

We would draw your attention to the need for you to remove all fixtures, fittings, floor coverings, stored articles, etc from the areas designated for treatments, prior to works commencing on site.

Replacement timbers will be to standard stock items, sections and mouldings, unless otherwise specified.

Our cost assessment covers only those items specifically stated in the report to be undertaken by the Specialist Contractor. All other repairs and/or ancillary works are to be the responsibility of others, under separate contract.

No allowance has been made in our cost assessment for the removal and subsequent re-instatement of any electrical, plumbing or other services unless otherwise stated.

At the time of the inspection, it was not possible to ascertain the construction of the masonry or the nature of the mortar joints. Our cost assessment is therefore based on the masonry being level, in sound condition and bonded with mortar. If, during the course of the work specified, extra work is found to be necessary due to the poor condition of the masonry you will be notified.

It will be seen our specification includes for the removal of existing plaster. In removing plaster, it is not unusual for dust to find its way to the remotest parts of the property. Whilst the Specialist Contractor will take precautions to minimise this nuisance wherever practicable within the immediate area of the works, we respectfully suggest that you should also take some precautions to protect furniture and the like elsewhere in the property. No responsibility is likely to be accepted by the Specialist Contractor for cleaning or for any damage that may be caused by dust.

Our inspection is based upon a close, but not intimate, examination of the areas specified. Inevitably, there will be concealed timbers that could not be inspected fully, or at all, without opening up. We have, as far as possible, inspected accessible exposed surfaces available to us. Our recommendations are, therefore, subject to the qualification that further necessary works may be required once the fabric of the building or a particular element is exposed, this applies particularly to dry rot. Should you require a full exploratory examination, we would be pleased to quote. If you proceed on the present basis, we shall advise you of any further infestation or fungal decay discovered during the execution of the works and advise/assess accordingly.

You should be aware that we have reported upon problems evident to us at the time of our visit, we are not commenting in any general sense on the risk of fungal decay or any other defect not evident at this time or that may develop in the future.

Where we have drawn your attention to other defects, these should be regarded as helpful suggestions and not a full complete assessment of any problems that may exist. External weathered timbers (eg, windows, fascias, etc) and outbuildings are not covered by the scope of our survey.

### **About Rowallan Specialist Surveys**

We are a local, independent company providing professional advice and remedial solutions in relation to timber and damp problems in buildings.

Our reliability, professionalism and integrity have been proven by our many repeat customers and referrers. A small selection of our testimonials can be viewed on our website [www.rowallansurveys.co.uk](http://www.rowallansurveys.co.uk).

We would like to thank you once again for choosing us to carry out this survey for you. Our customer's opinions and satisfaction are very important to us and we believe in offering an exceptional service. We will, for that reason, follow up with a brief online survey from a specialist customer research company and would be delighted if you could provide us with your feedback. In the meantime, if you would like to comment on any aspect of our service, please feel free to call our office or drop us an email at [info@rowallansurveys.co.uk](mailto:info@rowallansurveys.co.uk).

## Cost Assessment

We advise that a competitive cost to undertake **Works by Specialist Contractor** as specified in this survey report would be:

	£ 2900
VAT @ 20%	£ 580
<b>Total</b>	<b>£ 3480</b>


Whilst we do not undertake remedial works directly, we can arrange for the works specified to be undertaken by one of our **Approved Specialist Contractors**. Although any contract will be between the customer and the Approved Specialist Contractor, you can be confident that work will be undertaken in accordance with our specification by skilled and experienced technicians complying with stringent industry standards in terms of workmanship and health and safety. Works will be carried out with the minimum of disruption and within the cost assessed by ourselves (subject to a reasonable period for acceptance and fluctuations in material costs).

Please contact ourselves should you wish work to be undertaken by an Approved Specialist Contractor and we will provide them all the necessary information for them to contact you directly and arrange mutually convenient work dates.

Please also note that if remedial work specified is undertaken by one of our Approved Specialist Contractors, our survey fee will be refunded to you by the contractor on completion of the contract.


If works are undertaken by one of our **Approved Specialist Contractors**, upon final payment of the contract, a 20 year Guarantee will be issued offering you peace of mind by protecting your property for the future.


The surveyor who has been dealing with this property is Michael Caldow and can be contacted on telephone number 01563 529716 or mobile 07976 251978 or by e:mail at mc@rowallansurveys.co.uk.

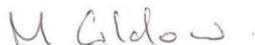

**Michael Caldow BSc CSRT CSSW**  
For Rowallan Specialist Surveys

Part Ground Floor Plan

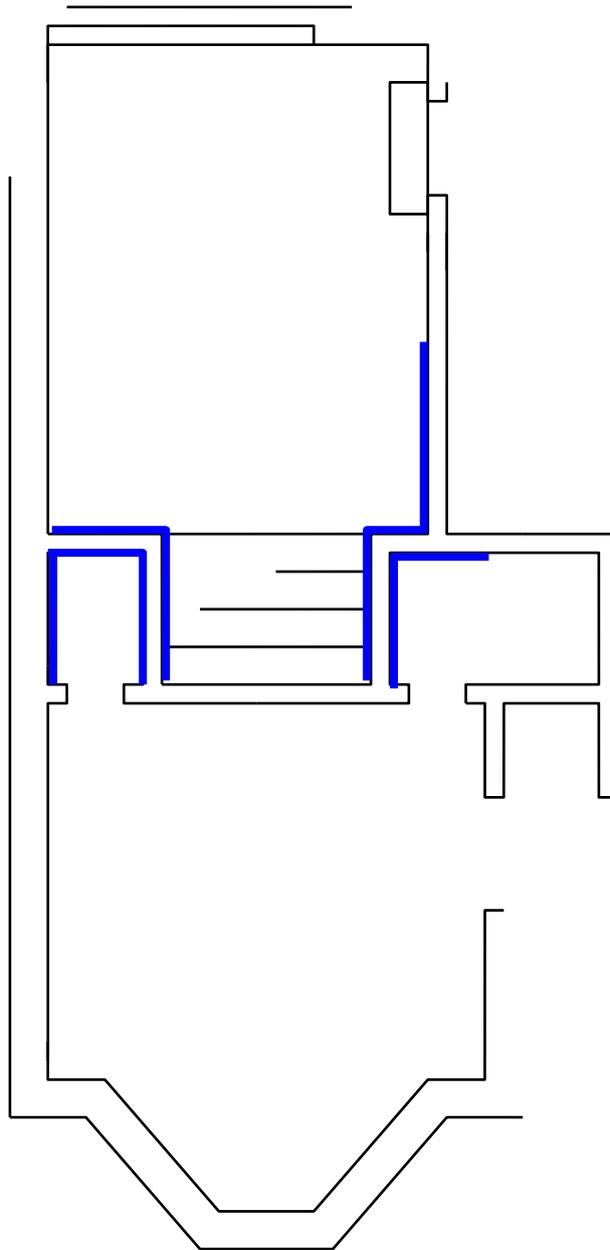

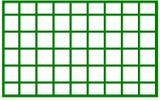	Chemical DPC		Renew flooring, deafening and joist sections		Clear, treat and seal solum		Renew lintel
	Membrane/ reline and plaster - approx 1.0m high		Renew joist sections		Renew ceiling		Renew beam
	Membrane/ reline and plaster - full height				Inspect/ treat joists		Inspect/ treat lintel